


hollis+morris

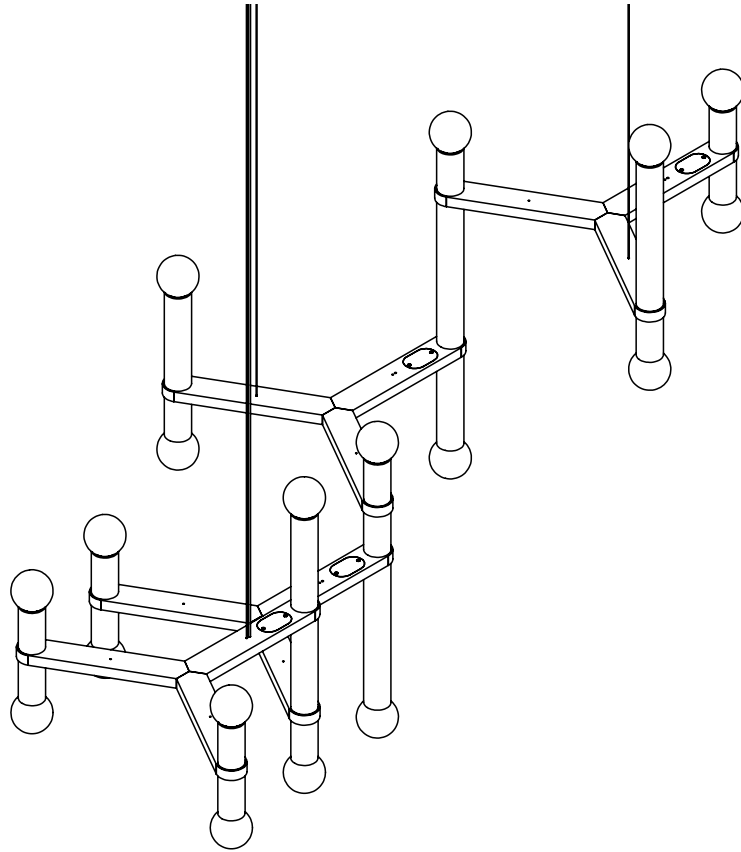

MOLECULE chandelier

product installation + specifications

product code:

MOLCchandelier



dimensions + installation

See Tearsheet for full product specifications

Fixture Assembly-- The fixture is shipped in two parts (A and B), two people are recommended for the assembly and installation process;

1. A work surface with a minimum height of 20" is required. (fig 1)
2. Remove **Template Cardboard** and place on work surface with arrow pointing to edge. Place **Part A** into **Template Cardboard** on work surface. (fig 2)


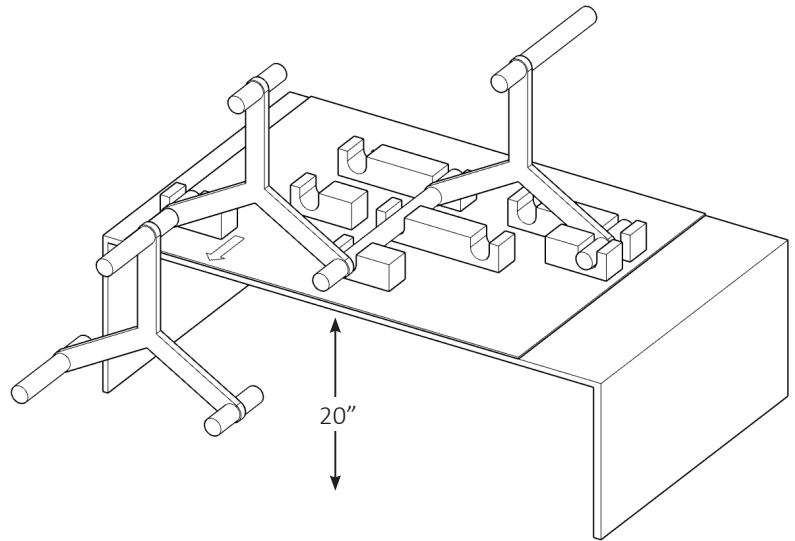


Figure 1

Figure 2

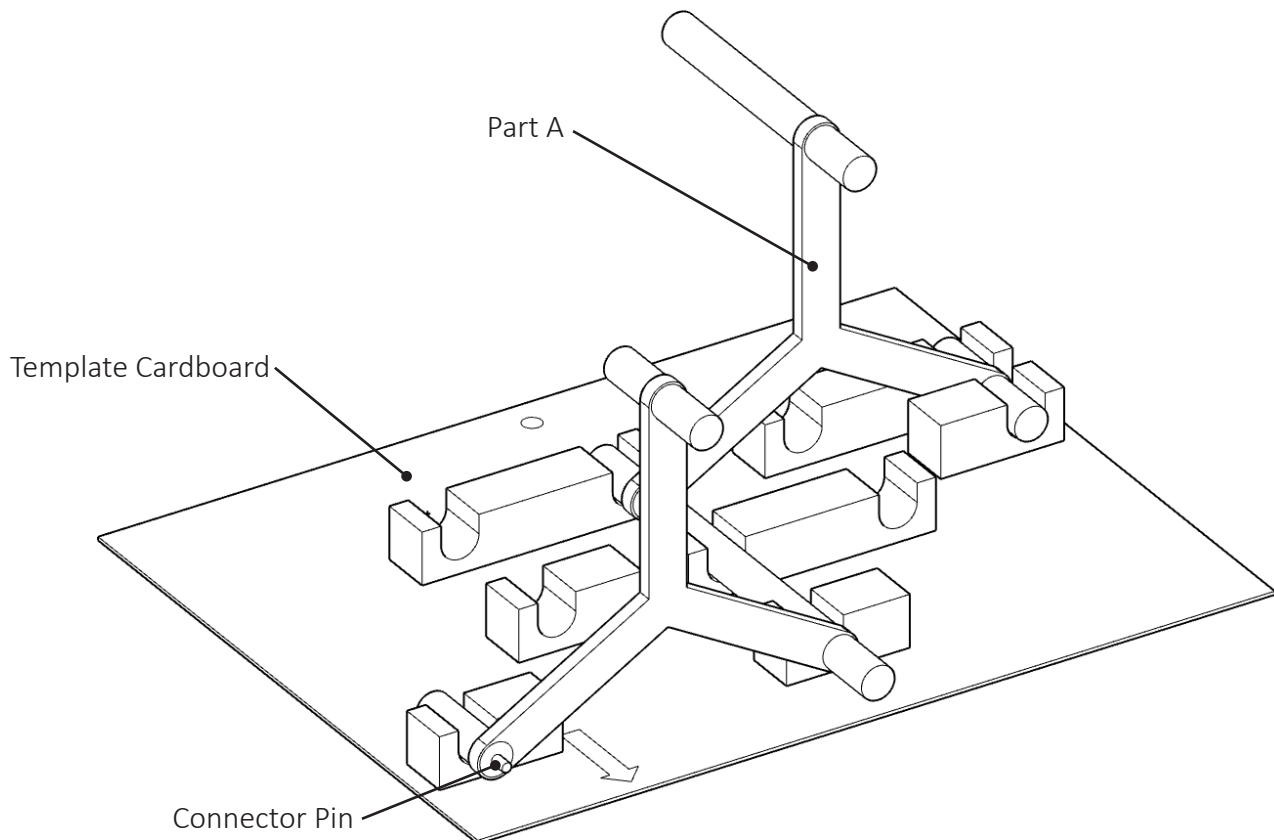

dimensions + installation

3. Use a cardboard inserts to help align *Part B* with *Part A*. (fig 3)
4. Unscrew *Socket Dowel* from *Part A*.
5. Slide the pin of *Part A* into the *Connector Dowel* of *Part B* and secure using the 2 provided *#6 screws*. (fig 4)
6. Screw *Socket Dowel* back on.

Assembly complete

Figure 3


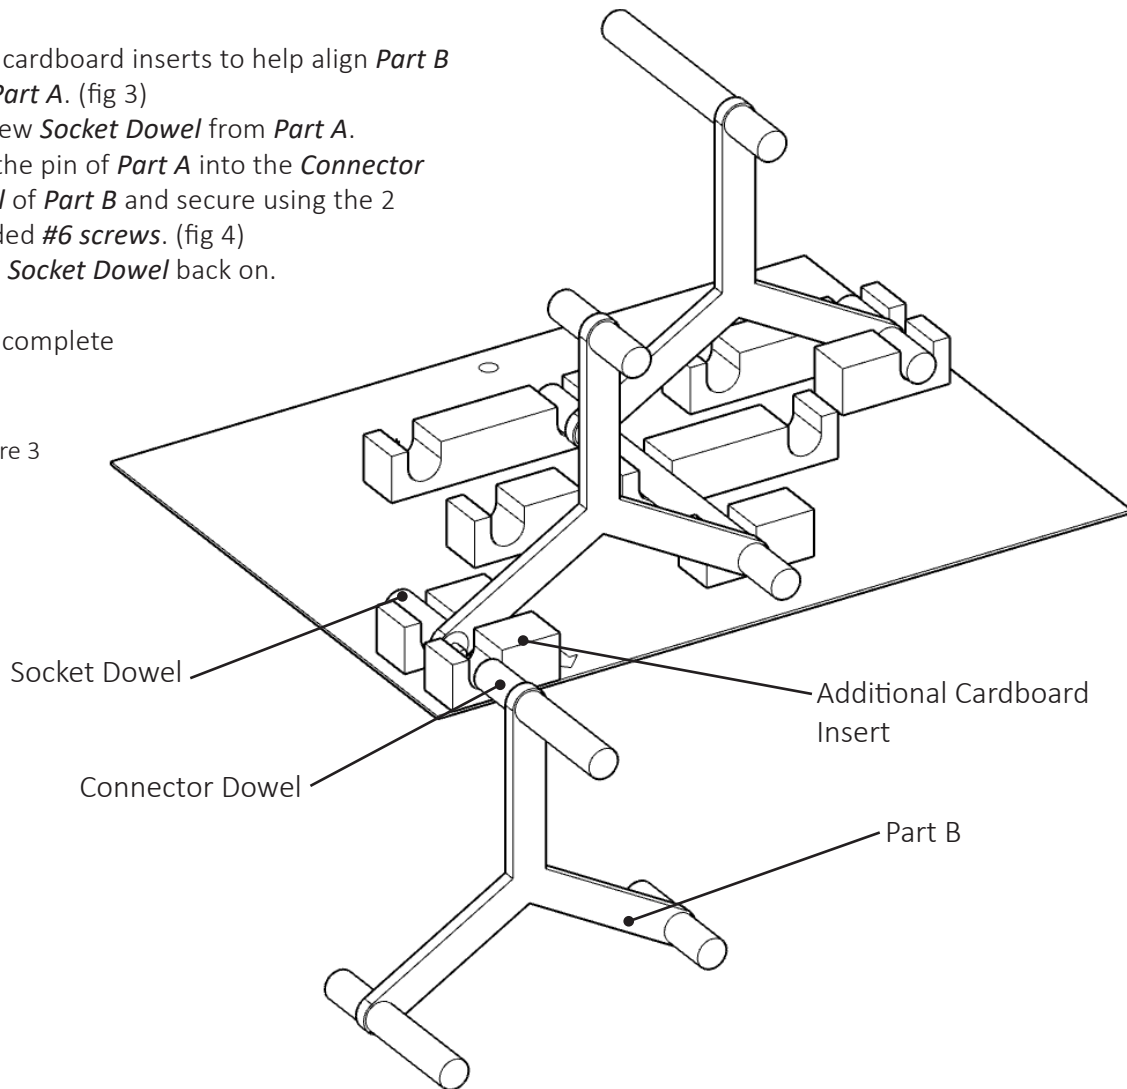


Figure 4

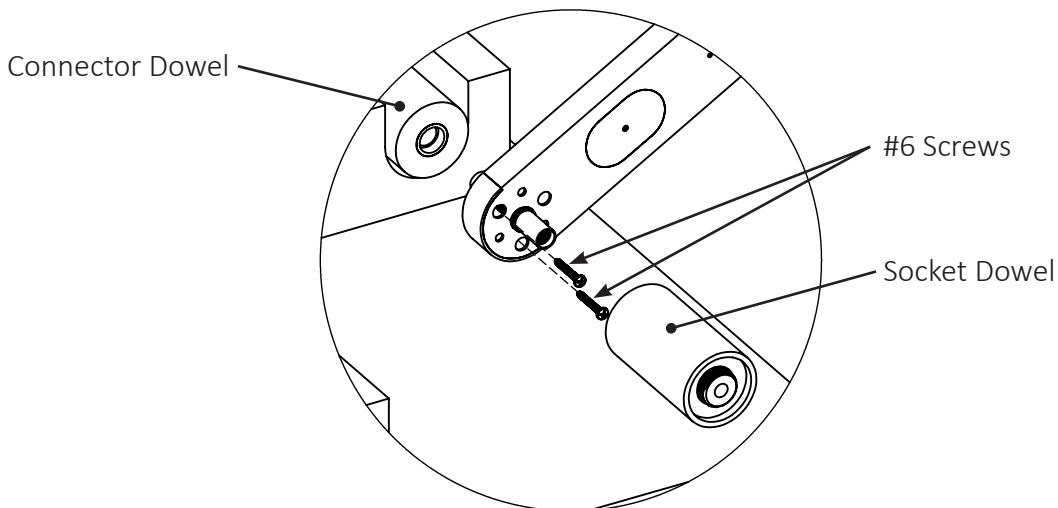


DETAIL A

dimensions + installation

Top View

- ⊗ Power Connection + Suspension Point
- × Suspension Point


*note dimensions are referenced off edge of metal and to center of suspension point

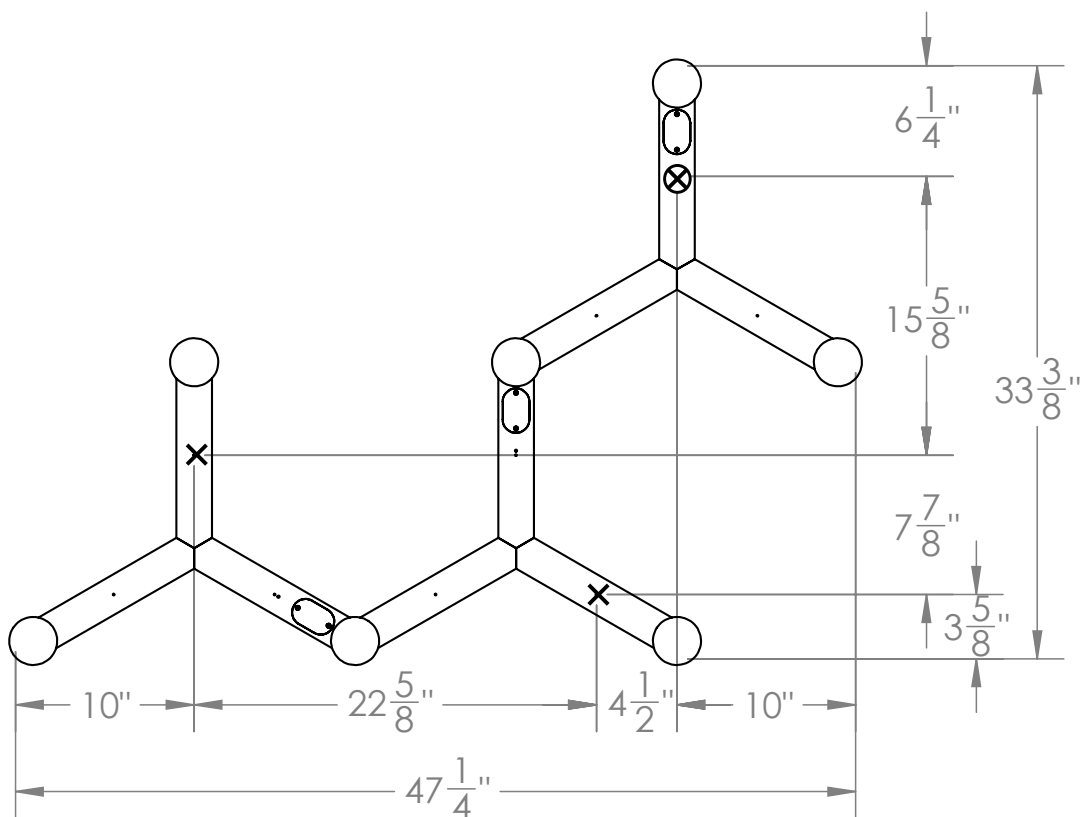


dimensions + installation

Elevation View - Canopy Connection


1. Locate desired canopy location on ceiling & have a certified electrician supply and connect driver to 120V power.
2. Feed suspension cable through the cable gripper on the canopy plate, and feed the coax cable through the designated hole in the canopy plate.
3. Connect the coax cable to the 12V driver. Then close the junction box with universal junction plate adapter followed by the canopy plate using the provided flat head screws.
4. Locate desired locations for suspension hardware and mount ceiling couplers to ceiling.
5. Feed additional suspension cables through cable grippers and screw cable gripper into ceiling coupler.
6. Adjust all cables to desired heights (standard length max = 120")

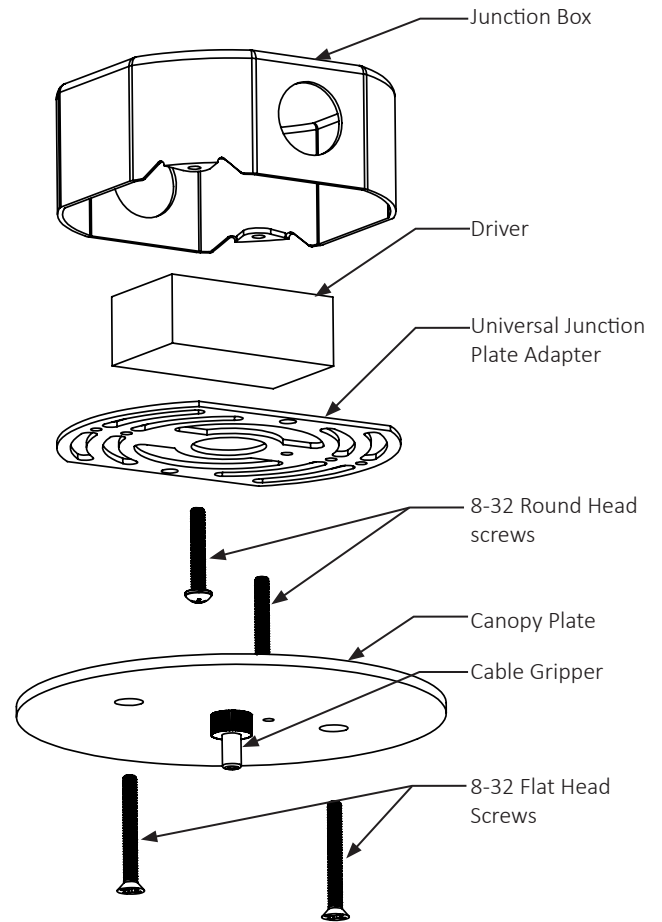

Suspension Hardware Assembly

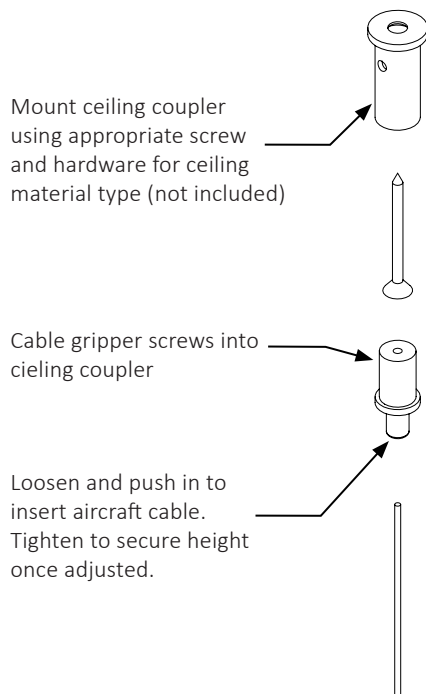


*** COAX CABLE

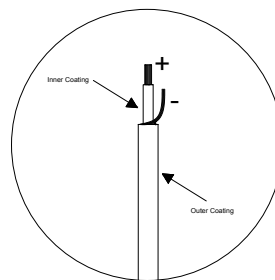


coax cable requires stripping of outer and inner coatings to access positive and negative connection wires

dimensions + installation


Option A - Support from canopy

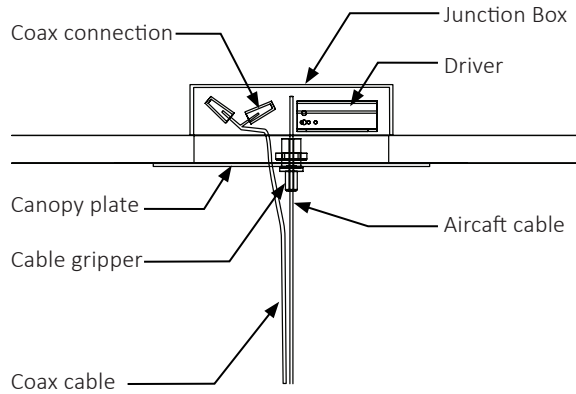

Option B - Support from ceiling

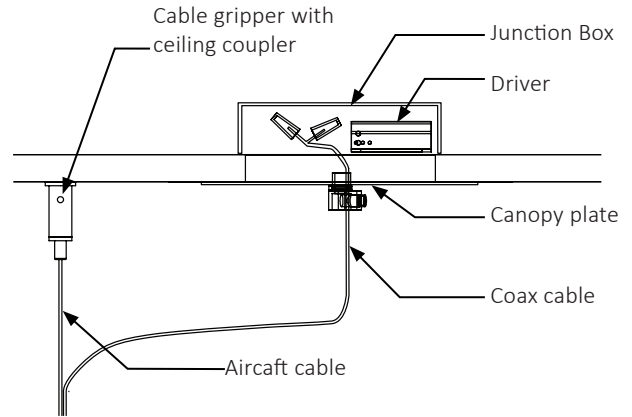

Canopy Plate Dimensions

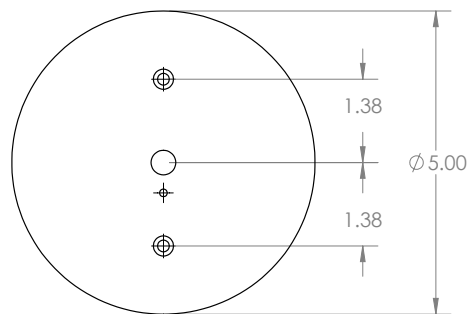

Bulb Installation

1. Insert G4 LED bulb into G4 socket before connecting to power.
2. Screw globe onto wood top.

